

# Intel<sup>®</sup> I/O Controller Hub 7 (ICH7) Family

Intel<sup>®</sup> ICH7 Family Specification Update

---

*October 2008*

**Notice:** The Intel<sup>®</sup> ICH7 Family product may contain design defects or errors known as errata which may cause the product to deviate from published specifications. Current characterized errata are documented in this specification update.



INFORMATION IN THIS DOCUMENT IS PROVIDED IN CONNECTION WITH INTEL® PRODUCTS. NO LICENSE, EXPRESS OR IMPLIED, BY ESTOPPEL OR OTHERWISE, TO ANY INTELLECTUAL PROPERTY RIGHTS IS GRANTED BY THIS DOCUMENT. EXCEPT AS PROVIDED IN INTEL'S TERMS AND CONDITIONS OF SALE FOR SUCH PRODUCTS, INTEL ASSUMES NO LIABILITY WHATSOEVER, AND INTEL DISCLAIMS ANY EXPRESS OR IMPLIED WARRANTY, RELATING TO SALE AND/OR USE OF INTEL PRODUCTS INCLUDING LIABILITY OR WARRANTIES RELATING TO FITNESS FOR A PARTICULAR PURPOSE, MERCHANTABILITY, OR INFRINGEMENT OF ANY PATENT, COPYRIGHT OR OTHER INTELLECTUAL PROPERTY RIGHT. Intel products are not intended for use in medical, life saving, or life sustaining applications.

Intel may make changes to specifications and product descriptions at any time, without notice.

Designers must not rely on the absence or characteristics of any features or instructions marked "reserved" or "undefined." Intel reserves these for future definition and shall have no responsibility whatsoever for conflicts or incompatibilities arising from future changes to them.


The Intel® I/O Controller Hub 7 (ICH7) Family components may contain design defects or errors known as errata which may cause the product to deviate from published specifications. Current characterized errata are available on request.

Contact your local Intel sales office or your distributor to obtain the latest specifications and before placing your product order.

Intel, and the Intel logo are trademarks or registered trademarks of Intel Corporation or its subsidiaries in the United States and other countries.

\*Other names and brands may be claimed as the property of others.

Copyright © 2005–2007, Intel Corporation

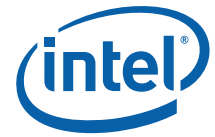

## Contents

---

Revision History .....	4
Preface.....	7
Summary Table of Changes.....	8
Identification Information.....	11
Errata .....	12
Specification Changes .....	19
Specification Clarifications .....	20
Document Changes .....	21



# Revision History

Revision	Description	Date
-001	Initial Release.	April 2005
-002	Added: Errata: 2-SATA AHCI Recovery From Task File Error, 3-PCI Express* Completion Timer in L1, 4-3 Gb/s SATA Signal Voltage Level. Specification Clarifications: 1-PATA Secondary Command/Control BAR, 2-AHCI Operation Clarification.	May 2005
-003	Added: Errata: 5-SATA Index/Data Pair Decode, 6-SATA 3 Gb/s Squelch Event, 7-PCI Express* False Correctable Error. Specification Changes: 1-SATA Capability Registers Disable Change, 2-IOL1/IOH1 Change, 3-INTVRMEN Input Threshold Change. Specification Clarifications: 3-AHCI Host Capability Register Change, 4-PCI Express* One x4 Clarification, 5-ASF Configuration Registers Clarification, 6-SM Bus Slave Read Tables, 7-Feature Detection Capability, 8-PME Pending, 9-Indeterminate State Before Power Stable.	June 2005
-004	Modified: Specification Clarification: 1-PATA Secondary Command/Control BAR. Added: Specification Clarification: 10-SATA Electrical Specification Clarification.	August 2005
-005	Specification Clarifications: 11-SPI Timings Corrections and 12-F0h Read Behavior Clarifications. Document Changes: 2-DC Current Characteristics Note Correction and 3-PCI Functional Description Correction.	September 2005
-006	Specification Clarifications: 13-PCI Downstream Device Disable Clarification, 14-Processor Initiated Passive Cooling Clarification, 15-LPC SERR Generation Behavior Clarification, and 16-t302 Clarification. Document Changes: 4-THRMTrip# Timing Correction, 5-LSTS Note Correction, and 6-AHCI CAP.SALP Attribute Correction.	October 2005
-007	Added: Specification Change: 4-Clock Gating Support Specification Change. Document Changes: 7-Interrupt Pin Register Reserved Bits Correction, 8-PCI Express Slot Power Register Description Additions, 9-GPIO Number Documentation Correction, and 10-USB Port Number Documentation Corrections.	November 2005
-008	Added: Specification Change: 5-Clock Gating Register Reserved Document Change: 11-LPC Cycle Change	December 2005
-009	Moved all Specification Changes, Specification Clarifications and Documentation Changes into parent datasheet (307013-002) Modified: Document Changes: 1- PCI Device Revision ID Added: ICH7DH, ICH7M, and ICH7M DH Marks Errata: 8-PCI Express* Scrambling, 9-ICH7M LPC and DMI L1, 10-ICH7M Intel® PRO/Wireless 3945ABG mode False Correctable Error during FTS with L0s, 11-ICH7M USB LS/FS Device behind a USB HS Hub, 12-ICH7M High Definition Audio Dynamic Clock Gating, 13-ICH7M PCI Dynamic Gating, 14-ICH7M Intel PRO/Wireless 3945ABG Host Interface Auto-Detect, 15-ICH7M PCI Express*Root Port Transmission SKP Sequence during L1 Entry	January 2006
-010	Added: Specification Change: 6-GPIO25 Functional Strap Change Specification Change: 7-ICH7M SKU Change	February 2006
-011	Added: Specification Change: 8-t200 Change Specification Clarification: 1-GNT[5:0]# Pull-up Clarification	March 2006



Revision	Description	Date
-012	Added: Erratum: 16-MW DMA Mode-1 Tdh Erratum Specification Clarification: 2-GPIO25 Functional Strap Clarification Document Changes: 2-ESD Register Description Correction, 3-PCI Express* Signal Name Correction, 4-t290 Clarification, 5-t293 Clarification, 6-t294 Clarification, 7-Signal "Type" Clarification, 8-Power Sequencing and Reset Signal Timings Clarification, 9-Input Signal Behavior Clarifications, 10-Vcc Clarification, 11-ATA/ATAPI-7 Support Addition	April 2006
-013	Added: Specification Clarification: 3-t232 Clarification Document Changes: 12-AZ_DOCK_EN#/GPIO33 Power Plane Change	May 2006
-014	Added: Errata: 17-ICH7M and ICH7M-DH UHCI Dynamic Clocking Gating, 18-Reset Command Received Through SMBus During Suspend Specification Changes: 9-RSMRST# Timing Addition Specification Clarifications: 4-DC Characteristic Clarifications, 5-SMBus Slave Write Clarification Document Changes: 13-Package Size Correction Modified Erratum #3 to correct a formatting error. Miscellaneous formatting corrections throughout the document.	July 2006
-015	Added: Errata: 19-PCI Express Root Port Power State Value Specification Clarifications: 6-PM1_EN Register Description Correction, 7-D29:F7 PCI Command Register Description Correction.	August 2006
-016	Added: Errata: 20-PCI Express Upstream Link Base Address Register Bit 0 Document Changes: 14-BIOSWE Bit Clarification	September 2006
-017	Added: Errata: 21-SATA Min Squelch Marginality at Hot Temperature	November 2006
-018	Added: Specification Changes: 10-t290, t293, and t294 Timing Change and t303 Addition Specification Clarifications: 8-t290, t293, t294 Clarification Document Changes: 15-RTC Update Cycle Inhibit (SET) bit Correction	December 2006
-019	Added: Document Changes: 16-APIC Enable (AEN) Bit Clarification, 17-Reset Control Register (CF9h) Clarification, 18-TP3 Replacing RTEST#	February 2007
-020	Added: Errata: 22-IDE Input Buffer V+and Vih Specification Violation, 23-UHCI Hang with USB Reset Document Changes: 19-PWROK Glitch-free Clarification, 20-RTC Clock Clarification	March 2007
-021	Added Specifications for 82801GU ICH7-U Removed: Specification Clarifications 1-8. Items were added to Datasheet, Revision -003. Documentation Changes 2-20. Items were added to Datasheet, Revision -003.	April 2007
-022	Added: Errata: 24-High Speed (HS) USB2.0 D+ and D- Maximum Driven Signal Level, 25-THRM Polarity on SMBus	September 2007
-023	Removed Specification Changes that have been incorporated into Datasheet, Revision -003. Reset the numbering scheme in all summary tables for easy reference. Added: Errata: 26-AHCI Reset and MSI Request Specification Changes: 2-Removing Support for USB Wake from S5 Document Changes: 2-AC '97 Misc Corrections.	November 2007
-024	Added: Errata:27-SATA Gen1 Initialization / LPM Erratum Document Changes: 3-SATA Port Control and Status Register Clarification	May 2008
-025	Added: Specification Clarifications: 1-t290, t293, and t294 Correction	October 2008





## Preface

---

This document is an update to the specifications contained in the Affected Documents/ Related Documents table below. This document is a compilation of device and documentation errata, specification clarifications and changes. It is intended for hardware system manufacturers and software developers of applications, operating systems, or tools.

Information types defined in Nomenclature are consolidated into the specification update and are no longer published in other documents.

This document may also contain information that was not previously published.

## Affected Documents/Related Documents

Title	Document Number
Intel® I/O Controller Hub 7(ICH7) Family Datasheet	307013-003

## Nomenclature

**Errata** are design defects or errors. Errata may cause the Intel® ICH7's behavior to deviate from published specifications. Hardware and software designed to be used with any given stepping must assume that all errata documented for that stepping are present in all devices.

**Specification Changes** are modifications to the current published specifications. These changes will be incorporated in any new release of the specification.

**Specification Clarifications** describe a specification in greater detail or further highlight a specification's impact to a complex design situation. These clarifications will be incorporated in any new release of the specification.

**Documentation Changes** include typos, errors, or omissions from the current published specifications. These will be incorporated in any new release of the specification.



## Summary Table of Changes

The following table indicates the Specification Changes, Errata, Specification Clarifications, or Documentation Changes which apply to the Intel® I/O Controller Hub 7 (ICH7) family. Intel intends to fix some of the errata in a future stepping of the component(s), and to account for the other outstanding issues through documentation or specification changes as noted. This table uses the following notations:

### Codes Used in Summary Table

#### Stepping

X: Specification Change, Erratum, Specification Clarification or Documentation Change that applies to a stepping or to this product line.

(No mark) or (Blank Box): This erratum is fixed in listed stepping or specification change does not apply to listed stepping.

#### Status

Doc: Document change or update that will be implemented.

PlanFix: This erratum may be fixed in a future stepping of the product.

Fixed: This erratum has been previously fixed.

No Fix: There are no plans to fix this erratum.

Bar: This item is either new or modified from the previous version of the document.

## Errata

Number	Stepping		Status	ERRATA
	A1	B0		
1	X	X	No Fix	ICH7 SATA COMINIT/COMWAKE Detection
2	X	X	No Fix	SATA AHCI Recovery From Task File Error
3	X	X	No Fix	PCI Express* Completion Timer in L1
4	X	X	No Fix	3 Gb/s SATA Signal Voltage Level
5	X	X	No Fix	SATA Index/Data Pair Decode
6	X	X	No Fix	SATA 3 Gb/s Squelch Event
7	X	X	No Fix	PCI Express* False Correctable Error
8	X	X	No Fix	PCI Express* Scrambling
9	X	X	No Fix	ICH7M/ICH7-U LPC and DMI L1
10	X	X	No Fix	ICH7M/ICH7-U Intel® PRO/Wireless 3945ABG mode False Correctable Error during FTS with L0s





## Errata

Number	Stepping		Status	ERRATA
	A1	B0		
11	X	X	No Fix	ICH7M/ICH7-U USB LS/FS Device behind a USB HS Hub
12	X	X	No Fix	ICH7M/ICH7-U High Definition Audio Dynamic Clock Gating
13	X	X	No Fix	ICH7M/ICH7-U PCI Dynamic Gating
14	X	X	No Fix	ICH7M/ICH7-U Intel PRO/Wireless 3945ABG Host Interface Auto-Detect
15	X	X	No Fix	ICH7M PCI Express* Root Port Transmission of SKP Sequence during L1 Entry
16	X	X	No Fix	MW DMA Mode-1 Tdh Erratum
17		X	No Fix	ICH7M/ICH7-U and ICH7M-DH UHCI Dynamic Clocking Gating
18	X	X	No Fix	Reset Command Received Through SMBus During Suspend
19	X	X	No Fix	PCI Express Root Port Power State Value
20	X	X	No Fix	PCI Express Upstream Link Base Address Register Bit 0
21	X		No Fix	SATA Min Squelch Marginality at Hot Temperature
22	X	X	No Fix	IDE Input Buffer V+ and Vih Specification Violation
23	X	X	No Fix	UHCI Hang with USB Reset
24	X	X	No Fix	High Speed (HS) USB2.0 D+ and D- Maximum Driven Signal Level
25	X	X	No Fix	THRM Polarity on SMBus
26	X	X	No Fix	AHCI Reset and MSI Request
27	X	X	No Fix	SATA Gen1 Initialization / LPM Erratum

## Specification Changes

Number	Stepping		SPECIFICATION CHANGES
	A1	B0	
1	X	X	D29:F7 PCI Command Register Description Correction
2	X	X	Removing Support for USB Wake from S5



## Specification Clarifications

No.	SPECIFICATION CLARIFICATIONS
1	t290, t293, and t294 Correction

## Documentation Changes

No.	DOCUMENTATION CHANGES
1	PCI Device Revision ID
2	AC '97 Misc Corrections
3	SATA Port Control and Status Register Clarification

§



## Identification Information

---

### Markings

ICH7 Stepping	S-Spec	Top Marking	Notes
A1	N/A	82801GB QI99 ES	Engineering Sample - ICH7 (Sn-Pb)
A1	N/A	82801GB QJ01 ES	Engineering Sample - ICH7 (Lead-free)
A1	N/A	82801GR QJ04 ES	Engineering Sample - ICH7R (RAID) (Sn-Pb)
A1	N/A	82801GR QJ05 ES	Engineering Sample - ICH7R (RAID) (Lead-free)
A1	SL8FX	82801GB SL8FX	Production - ICH7 (Lead-free)
A1	SL8FY	82801GR SL8FY	Production - ICH7R (Lead-free)
A1	SL8KL	82801GR SL8KL	Production - ICH7R (Sn-Pb)
A1	N/A	82801GDH QJ03ES	Engineering Sample - ICH7DH (Lead-free)
A1	N/A	82801GHM QJ09ES	Engineering Sample - ICH7M DH (Lead-free)
B0	N/A	82801GBM QK65ES	Engineering Sample - ICH7M (Lead-free)
B0	N/A	82801GHM QK17ES	Engineering Sample - ICH7M DH (Lead-free)
A1	SL8UK	82801GDH SL8UK	Production - ICH7DH (Lead-free)
B0	SL8YR	82801GHM SL8YR	Production - ICH7M DH (Lead-free)
B0	SL8YB	82801GBM SL8YB	Production - ICH7M (Lead-free)
B0	SLA23	PC82801GU	Production - ICH7-U (Lead-free)

§



## Errata

---

### 1. SATA COMINIT/COMWAKE Detection

**Problem:** During Out-Of-Band (OOB) sequencing, the ICH7 may detect COMINIT/COMWAKE when only 2 or 3 bursts of ALIGNs are received from the SATA device instead of the required 4 bursts as per the SATA 1.0a Specification.

**Implication:** None Known - The ICH7 appropriately handles subsequent ALIGNs.

**Workaround:** None.

**Status:** No Fix. For steppings affected, see the *Summary Tables of Changes*

### 2. SATA AHCI Recovery From Task File Error

**Problem:** During an AHCI fatal error condition, if the device signals a Task File Error (TFES), the ICH7 may not be able to recover correctly after software performs the AHCI spec-defined fatal error recovery mechanism.

**Implication:** SATA port will appear busy resulting in the device being inaccessible.

**Note:** IAA/IMST 4.0 and later implements a reset mechanism that does not allow this issue to be exposed. Furthermore this condition has only been replicated in a synthetic test environment.

**Workaround:** AHCI driver should toggle the ST bit to '1' and back to '0' upon detecting TFES bit set after ST bit is cleared.

**Status:** No Fix. For steppings affected, see the *Summary Tables of Changes*

### 3. PCI Express\* Completion Timer in L1


**Problem:** The ICH7 PCI Express Completion Timer always halts when the PCI Express link enters the L1 state. According to the PCI Express specification, Rev 1.0a, the timer should continue running during Active State Power Management (ASPM)-initiated L1 states.

**Implication:** No known implications with devices that meet the PCI Express 1.0a specification.

The system may hang if a PCI Express device enters the ASPM L1 state before sending all completions for an outstanding non-posted request. Note that since the PCI Express specification requires that endpoints send all pending completions before entering ASPM L1, a system hang of this nature requires a device that is not fully compliant with the PCI Express specification. This issue has only been replicated in a synthetic environment.

**Workaround:** None

**Status:** No Fix. For steppings affected, see the *Summary Tables of Changes*

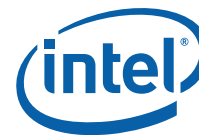

#### 4. 3 Gb/s SATA Signal Voltage Level

**Problem:** The ICH7 3 Gb/s SATA transmit buffers have been designed to maximize performance and robustness over a variety of routing scenarios. As a result, the ICH7 SATA transmit signaling voltage levels may exceed the maximum motherboard TX connector and device RX connector voltage specifications (section 6.2.1 of Serial ATA II Electrical Specification, Rev 1.0).

**Implication:** None known.

**Workaround:** None.

**Status:** No Fix. For steppings affected, see the *Summary Tables of Changes*

#### 5. SATA Index/Data Pair Decode

**Problem:** The ICH7 SATA controller does not properly decode SATA index/data pair transactions when I/O trapping is enabled.

**Implication:** SATA index/data pair accesses are not required for ICH7 configuration or functionality. If I/O trapping is enabled, SATA index/data pair register access may return unexpected data.

**Workaround:** BIOS workaround available. Contact your Intel field Representative for details.

**Status:** No Fix. For steppings affected, see the *Summary Tables of Changes*

#### 6. SATA 3 Gb/s Squelch Event

**Problem:** When subjected to a specific high-frequency test pattern for an extended time period with a very low receive amplitude at the motherboard connector, the ICH7 may inaccurately detect a squelch event when the SATA link is operating at 3 Gb/s.

**Implication:** A squelch event may cause the 3 Gb/s SATA device to become unavailable and/or the system may hang. Note: this issue has only been replicated in an artificial test environment and has not been reported with known SATA devices. No application failures have been observed in a real world environment.

**Workaround:** None.

**Status:** No Fix. For steppings affected, see the *Summary Tables of Changes*

#### 7. PCI Express\* False Correctable Error

**Problem:** During L0s and/or L1 entry or exit on the PCI Express root ports, the ICH7 may acknowledge a correctable error, which violates the PCI Express spec, 1.0a. This is reported thru the Correctable Error Detected bit (D28:F0/F1/F2/F3/F4/F5:Offset 4Ah:bit-0) and the Receiver Error Status bit (D28:F0/F1/F2/F3/F4/F5:Offset 150h: bit-0).

**Implication:** No system functionality issues observed. However, correctable error logging may not accurately report the number of errors.

Note: No known end-user SW uses this logging capability.

**Workaround:** None.

**Status:** No Fix. For steppings affected, see the *Summary Tables of Changes*



## 8. PCI Express\* Scrambling

**Problem:** While entering the Recovery state, the ICH7 stops scrambling two symbols before the first TS (training sequence).

**Implication:** When these non-scrambled symbols are received by the endpoint, the de-scrambler of the endpoint will observe two symbols of random data. The first symbol of TS1 will reset the endpoint's de-scrambler so that the endpoint should recognize the TS1 and TS2 ordered-sets being transmitted and move into the Recovery state as planned.

There is no system level impact if the endpoint is PCI Express Specification 1.0a compliant in ignoring the random data.

**Workaround:** None.

**Status:** No Fix. For steppings affected, see the *Summary Tables of Changes*

## 9. ICH7M/ICH7-U LPC and DMI L1

**Problem:** Under certain circumstances ICH7M/ICH7-U may initiate DMI L1 entry outside of C3/C4 while intermittent burst transfers are occurring by a LPC bus master.

**Implication:** Possible long latency when transferring data by a LPC bus master device due to L1 exit latency.

**Workaround:** BIOS workaround available. Contact your Intel field representative for details.

**Status:** No Fix. For steppings affected, see the *Summary Tables of Changes*

## 10. ICH7M/ICH7-U Intel® PRO/Wireless 3945ABG mode False Correctable Error during FTS with L0s

**Problem:** During L0s exit, the ICH7 may erroneously report correctable receiver errors while the PCI Express link is operating in Intel® PRO/Wireless 3945ABG mode. This is reported thru the Correctable Error Detected bit (D28:F0/F1/F2/F3/F4/F5: Offset 4Ah: bit 0) and the Receiver Error Status bit (D28:F0/F1/F2/F3/F4/F5: Offset 150h: bit 0).

**Implication:** No system functionality issues observed. However, correctable error logging may not accurately report the number of errors. Note: No known end-user SW uses this logging capability.

**Workaround:** None.

**Status:** No Fix. For steppings affected, see the *Summary Tables of Changes*

## 11. ICH7M/ICH7-U USB LS/FS Device behind a USB HS Hub

**Problem:** ICH7M/ICH7-U incorrectly processes a split transaction when a USB Low Speed/Full Speed device is connected to ICH7M/ICH7-U through a USB High Speed Hub.

**Implication:** Some USB Low Speed/Full Speed devices may not function properly when connected to the ICH7M/ICH7-U root port through a USB High Speed hub.

**Workaround:** BIOS workaround available. Contact your Intel field representative for details.

**Status:** No Fix. For steppings affected, see the *Summary Tables of Changes*

## 12. ICH7M/ICH7-U High Definition Audio Dynamic Clock Gating

**Problem:** ICH7M/ICH7-U may access incorrect memory location when a High Definition Audio device is installed and High Definition Audio dynamic clock gating is enabled.

**Implication:** Some High Definition Audio devices may not function properly with ICH7M/ICH7-U and may result in a NMI.

**Workaround:** BIOS workaround available. Contact your Intel field representative for details.

**Status:** No Fix. For steppings affected, see the *Summary Tables of Changes*



### 13. ICH7M/ICH7-U PCI Dynamic Gating

**Problem:** ICH7M/ICH7-U PCI Dynamic gating feature introduced a circuit isolation problem.

**Implication:** Use of PCI Dynamic Gating can severely impact product functionality.

**Workaround:** BIOS must ensure PCI Dynamic Gating is disabled. BIOS must ensure RCBA + 341Ch[16] = 0 during boot and resume sequence. Contact your Intel field representative for details.

**Status:** No Fix. For steppings affected, see the *Summary Tables of Changes*

### 14. ICH7M/ICH7-U Intel® PRO/Wireless 3945ABG Host Interface Auto-Detect

**Problem:** During the ICH7M/ICH7-U auto-detect sequence for Intel PRO/Wireless 3945ABG host interface mini-card device, there is a potential failure due to a timing, voltage, and temperature related boundary condition. Failure occurs only with Intel PRO/Wireless 3945ABG mini-card devices.

**Implication:** Intermittent enumeration failures may occur with Intel PRO/Wireless 3945ABG mini-card devices on ICH7M/ICH7-U-based platforms.

**Workaround:** BIOS workaround available. Contact your Intel field representative for details.

**Status:** No Fix. For steppings affected, see the *Summary Tables of Changes*

### 15. ICH7M PCI Express Root Port Transmission of SKP Sequence During L1 Entry

**Problem:** During L1 entry, ICH7M currently follows the PCI Express Spec 1.0a section 5.3.2.1 and transmits a continuous stream of PM Request ACK DLLPs but will not send SKP ordered sets, as permitted by PCI Express specification errata C7, even if the interval between SKPordered set has exceeded the 1180 to 1538 symbol times.

**Implication:** With certain receiver designs that are incapable of tolerating this sequence, in such systems a hang or NMI may occur.

**Workaround:** None

**Status:** No Fix. For steppings affected, see the *Summary Tables of Changes*

### 16. MW DMA Mode-1 Tdh Erratum

**Problem:** Data hold time of MW DMA Mode-1 writes may not meet ATA specification.

**Implication:** None known.

**Workaround:** Program the controller to PIO Mode-4 instead.

**Status:** No Fix. For steppings affected, see the *Summary Tables of Changes*.



## 17. ICH7M/ICH7-U and ICH7M-DH UHCI Dynamic Clock Gating

**Problem:** With ICH7M/ICH7-U and ICH7M-DH UHCI Dynamic Clock Gating enabled, under certain conditions, toggling the UHCI Controller Run/Stop control bit may result in the controller continuously accessing the Transaction Description Link List via DMA cycles.

- The condition may occur when clearing the UHCI Run/Stop bit between initiation and completion of an upstream UHCI memory request.
- The condition may occur with either Low-speed/Full-speed devices populated or unpopulated.
- Affects platforms with ICH7M/ICH7-U and ICH7M-DH, when UHCI Dynamic Clock Gating is enabled

**Implication:** - The system may not enter a C-state due to continuous DMA traffic.  
- A system hang may occur when entering S3/4/5 sleep state.  
-The system hang case has been observed with USB Wake support enabled

**Workaround:** BIOS workaround available. Contact your Intel field representative for details.

**Status:** No Fix. For steppings affected, see the *Summary Tables of Changes*.

## 18. Reset Command Received Through SMBus During Suspend

**Problem:** If the ICH7 is sent a 'Hard Reset Without Cycling' command on SMBus while the system is in S3, the reset command will not be executed until the next wake event. The ASF Spec, rev 1.03, requires the ICH7 to execute the Hard Reset Without Cycling immediately.

**Implication:** SMBus write commands that are sent after the Hard Reset Without Cycling command and before the wake event will be NAKed by the ICH7. This also applies to any SMBus wake commands sent after a Hard Reset Without Cycling command, such that the SMBus wake command will not cause the system to wake.

**Note:** Intel® Active Management Technology is not impacted as Intel AMT does not use the Hard Reset Without Cycling command while the system is in S3.

**Note:** Any SMBus read that is accepted by the ICH7 will complete normally

**Workaround:** Do not send a Hard Reset Without Cycling command while the system is in S3.

**Note:** Exposure to this issue can be reduced by issuing a wake command prior to issuing the Hard Reset Without Cycling command.

**Status:** No Fix. For steppings affected, see the *Summary Tables of Changes*.

## 19. PCI Express Root Port Power State Value

**Problem:** The ICH7 PCI Express root ports support the D3 and D0 states, but also accept writes of values corresponding to the D2 and D1 states in the Power State bit field of the Power Management Control and Status registers (D28:F0/F1/F2/F3/F4/F5:A4h). The ICH7 PCI Express root port PCI Power Management Capabilities Registers (D28:F0/F1/F2/F3/F4/F5:A2h) do not claim support of D2 and D1 power states.

**Implication:** No functional implications known. Writes of values corresponding to the D2 and D1 states (i.e., 10b or 01b) do not cause behavioral changes within the ICH7, but the value is displayed in the Power State bit field.

**Workaround:** Software should not write unsupported power state values (i.e., 10b or 01b) to the Power State bit field of the Power Management Control and Status register.

**Status:** No Fix. For steppings affected, see the *Summary Tables of Changes*.





## 20. PCI Express Upstream Link Base Address Register Bit 0

**Problem:** The ICH7 PCI Express root ports' Upstream Link Base Address (ULBA) Register (D28:F0/F1/F2/F3/F4/F5:198h) bit 0 mirrors the value of bit 0 in the ICH7 RCBA register (D31:F0:F0h). During normal system operation, bit 0 of the RCBA register is set to 1. This results in bit 0 of the ULBA also being set to 1. The PCI Express specification, rev 1.0a, requires that bit 0 of the ULBA be 0.

**Implication:** No functional implications known.

**Workaround:** None.

**Status:** No Fix. For steppings affected, see the *Summary Tables of Changes*.

## 21. SATA Min Squelch Marginality at Hot Temperature

**Problem:** The ICH7 SATA min squelch voltage may violate the SATA specification at case temperature of 85°C or above.

**Implication:** Squelch violation may cause a SATA drive detection failure resulting in either error message or blue screen, depending on the drive being re-detected and the type of detection scenario that is occurring: boot, system reset, active power management, resume from S3-S5, or when an error on the SATA wire is experienced.

**Note:** The ICH7 case temperature is not typically above 85°C during these drive detection scenarios.

**Workaround:** None.

**Note:** Exposure to the issue can be eliminated through effective system thermal design.

**Status:** No Fix. For steppings affected, see the *Summary Tables of Changes*.

## 22. IDE Input Buffer V+ and Vih Specification Violation

**Problem:** Under maximum voltage condition of the Vcc3\_3 power rail (3.465 V), the ICH7 may violate the PATA IDE V+ max (low-to-high input threshold) and Vih2 min (input high voltage) specifications. The limit in both cases is specified as 2.0 V.

**Implication:** The ICH7 may not switch on a low-to-high transition until V+ max is at 2.1 V, and may not register a logic high until Vih2 min is at 2.1 V. There is no known impact to system functionality. This issue has only been seen in a synthetic test environment, as an IDE device typically drives the input to 3.3 V.

**Workaround:** None.

**Status:** No fix. For steppings affected, see the *Summary Tables of Changes*.

## 23. UHCI Hang with USB Reset

**Problem:** When SW initiates a Host Controller Reset or a USB Global Reset while concurrent traffic occurs on at least three UHCI controllers, the UHCI controller(s) may hang. The issue has only been replicated in a synthetic reset test environment.

**Implication:** System may hang.

**Workaround:** BIOS workaround available. Contact your Intel field representative for more details.

**Status:** No fix. For steppings affected, see the *Summary Tables of Changes*.

## 24. High Speed (HS) USB2.0 D+ and D- Maximum Driven Signal Level

**Problem:** During Start-of-Packet (SOP)/End-of-Packet (EOP), the ICH7 may drive D+ and D- lines to a level greater than USB 2.0 spec +/-200mV max.

**Implication:** May cause High Speed (HS) USB 2.0 devices to be unrecognized by OS or may not be readable/writable if the following two conditions are met:

- The receiver is pseudo differential design



- The receiver is not able to ignore SE1 (single-ended) state

**Note:** Intel has only observed this issue with a motherboard down HS USB 2.0 device using pseudo differential design. This issue will not affect HS USB 2.0 devices with complementary differential design or Low Speed (LS) and Full Speed (FS) devices

Workaround: None.

Status: No Fix. For steppings affected, see the *Summary Tables of Changes*.

## 25. THRM Polarity on SMBus

**Problem:** When THRM#\_POL (PMBASE+42h:bit0) is set to high, the THRM# pin state as reported to the SMBus TCO unit is logically inverted.

**Implication:** If the THRM#\_POL bit is set to high, an external SMBus master reading the BTI Temperature Event status will not receive the correct state of the THRM# pin. The value will be logically inverted. If THRM#\_POL set to low, value is correct.

Workaround: None.

Status: No Fix. For steppings affected, see the *Summary Tables of Changes*.

## 26. AHCI Reset and MSI Request

**Problem:** If the ICH7 AHCI SATA controller receives a HBA reset while MSI interrupts are enabled, a boundary condition exists where the ICH7 SATA controller may respond to a non-posted request that is intended for another ICH7 function.

**Implication:** Issue has only been observed in a synthetic test environment. Unexpected system behavior may occur. System implication may vary depending on the non-posted request that is fulfilled.

**Note:** Intel® Matrix Storage Manager AHCI driver does not use the HBA reset command. Linux may enable MSIs and use the HBA reset command. No other third-party software known to utilize MSI interrupts.

**Workaround:** Prior to performing an HBA reset, software should disable AHCI interrupts by writing a '0' to Interrupt Enable bit (ABAR+04h, bit 1) and then perform a read to the AHCI GHC register (ABAR+04h).

Status: No Fix.

## 27. SATA Gen1 Initialization/LPM Erratum

**Problem:** During SATA Initialization routines or while resuming from a Link Power Managed (LPM) state, the ICH7 SATA link to Gen1 (1.5 Gb/s) devices may fail to be established.

**Implication:** One or more of the following symptoms may occur:

- During Boot or Resume from S4/S5: SATA Gen1 devices may not be detected, resulting in "Operating System Not Found" error.
- During Resume from S3: System may hang when attempting to initialize SATA Gen1 devices.
- During S0: If LPM is enabled and ALL SATA Gen1 devices within the system support LPM, slow SATA Gen1 performance may occur.

**Workaround:** BIOS workaround available.  
Contact your Intel field representative for more details.

Status: No Fix. For steppings affected, see the *Summary Table of Changes*.



## Specification Changes

### 1. D29:F7 PCI Command Register Description Correction

In Section 13.1.3, the description of bit 6 in the PCI Command Register (D29:F7) is corrected as indicated below.

6	<p><b>Parity Error Response</b>—R/W.</p> <p>When set to 1, the EHCI Host Controller will check for correct parity and halt operation when bad parity is detected during the data phase as recommended by the EHCI specification. If it detects bad parity on the address or command phases when this bit is set to 1, the host controller does not take the cycle, halts the host controller (if currently not halted) and sets the host system error bit in the USBSTS register. Note that this applies to both requests and completions from the system interface.</p> <p>This bit must be set in order for the parity errors to generate SERR#.</p>
---	--

### 2. Removing Support for USB Wake from S5

Support for USB wake from S5 is removed from Datasheet as indicated below.

a. Update Intel® ICH7 Features page of the Datasheet as follows:

USB 2.0

- Includes four UHCI Host Controllers, supporting eight external ports
- Includes one EHCI Host Controllers that support all eight ports
- Includes one USB 2.0 High-speed Debug Ports
- Supports wake-up from sleeping states **S1–S4**
- Supports legacy Keyboard/Mouse software

b. Update Table 5-31 as follows:

**Table 5-31. Causes of Wake Events**

Cause	States Can Wake From	How Enabled
Classic USB	S1–S4	Set USB1_EN, USB 2_EN, USB3_EN, and USB4_EN bits in GPE0_EN register



## Specification Clarifications

---

### 1. **t290, t293, and t294 Clarification**

Note 14 for t290, t293, and t294 in Table 23-23 of the Datasheet is changed as indicated below:

14. t290, t293, and t294 apply during S0 to S3/S4/S5 and S0 to G3 transitions. In addition, the timings are not applied to V5REF. V5REF timings are bounded by power sequencing.



## Document Changes

### 1. PCI Device Revision ID

PCI Revision ID Register values (PCI Offset 08h) for all ICH7 functions are shown below. This information is not found in the datasheet. This is the standard reference document.

Device Function	Description	Intel® ICH7 Dev ID <sup>1</sup>	ICH7 A1 Rev ID	ICH7 B0 Rev ID	Comments
D31, F0	LPC	27B8h	01h	N/A	ICH7, ICH7R
		27B9h	01h	02h	ICH7M, ICH7U
		27BDh	01h	02h	ICH7M DH
D31, F1	IDE	27DFh	01h	02h	
D31, F2	SATA	27C0h	01h	N/A	Desktop Non-AHCI and Non-RAID Mode <sup>1</sup>
		27C1h	01h	N/A	Desktop AHCI Mode <sup>1</sup>
		27C3h	01h	N/A	Desktop RAID Mode <sup>1</sup>
		27C4h	01h	02h	Mobile Non-AHCI and Non-RAID Mode <sup>1</sup>
		27C5h	01h	02h	Mobile AHCI Mode <sup>1</sup>
		27C6h	01h	02h	ICH7M DH RAID Mode <sup>1</sup>
D31, F3	SMBus	27DAh	01h	02h	
D30, F0	DMI to PCI Bridge	244Eh	E1h	N/A	Desktop
		2448h	E1h	E2h	Mobile, Ultra Mobile
D30, F2	AC '97 Audio	27DEh	01h	02h	
D30, F3	AC '97 Modem	27DDh	01h	02h	
D29, F0	USB UHC #1	27C8h	01h	02h	
D29, F1	USB UHC #2	27C9h	01h	02h	
D29, F2	USB UHC #3	27CAh	01h	02h	
D29, F3	USB UHC #4	27CBh	01h	02h	
D29, F7	USB EHCI	27CCh	01h	02h	
D28:F0	PCI Express* Port 1	27D0	01h	02h	
D28:F1	PCI Express Port 2	27D2	01h	02h	
D28:F2	PCI Express Port 3	27D4	01h	02h	
D28:F3	PCI Express Port 4	27D6	01h	02h	
D28:F4	PCI Express Port 5	27E0	01h	02h	ICH7R, ICH7DH, ICH7M DH



Device Function	Description	Intel® ICH7 Dev ID <sup>1</sup>	ICH7 A1 Rev ID	ICH7 B0 Rev ID	Comments
D28:F5	PCI Express Port 6	27E2	01h	02h	ICH7R, ICH7DH, ICH7M DH
D27:F0	Intel® High Definition Audio	27D8	01h	02h	
D8:F0	LAN	See Note 2	01h	02h	

**Notes:**

1. ICH7 contains a single SATA device. The SATA Device ID is dependent upon which mode is selected by BIOS and what RAID capabilities exist in the SKU.
2. Loaded from EEPROM. If EEPROM contains either 0000h or FFFFh in the device ID location, then 27DCh is used. Refer to the ICH7 EEPROM Map and Programming Guide for LAN Device IDs.

## 2. AC '97 Misc Corrections

The following changes apply to the note below Table 5-59 of the Datasheet.

**Note:** Throughout this document, references to **D30:F2** indicate that the audio function exists in **PCI Device 30, Function 2**. References to **D30:F3** indicate that the modem function exists in **PCI Device 30, Function 3**.

## 3. SATA Port Control and Status Register Clarification

The following change applies to Section 12.1.34 of the Datasheet.

### PCS - Port Control and Status Register (SATA-D31:F2)

Address Offset:	92h–93h	Attribute:	R/W, R/WC, RO
Default Value:	0000h	Size:	16 bits

By default, the SATA ports are set to the disabled state (bits [3:0] = '0'). When enabled by software, the ports can transition between the on, partial, and slumber states and can detect devices. When disabled, the port is in the "off" state and cannot detect any devices.

If an AHCI-aware or RAID enabled operating system is being booted then system BIOS shall insure that all supported SATA ports are enabled prior to passing control to the OS. Once the AHCI aware OS is booted it becomes the enabling/disabling policy owner for the individual SATA ports. This is accomplished by manipulating a port's PxSCTL and PxCMD fields. Because an AHCI or RAID aware OS will typically not have knowledge of the PxE bits and because the PxE bits act as master on/off switches for the ports, pre-boot software must insure that these bits are set to '1' prior to booting the OS, regardless as to whether or not a device is currently on the port.

§ §